





1234 Main St Miami FL 10000

Sent: Thu, 28 Jan 2021 11:39

PREPARED BY:

Dave Woodhouse

QUESTIONS?
CLICK HERE TO GET HELP

Summary

| Painter/DryWall | \$3700 | |
|-------------------------|--------|---|
| Electrician | \$2101 | |
| Carpenter/Handyman | \$1749 | |
| Landscaper | \$1404 | |
| Roofing | \$1370 | |
| Plumber | \$1052 | |
| Further Action Required | \$787 | _ |
| Flooring | \$540 | _ |
| HVAC | \$530 | _ |
| Framer | \$450 | _ |
| Vents | \$360 | _ |
| Window | \$320 | _ |
| Concrete Contractor | \$250 | _ |
| Appliance | \$210 | - |
| Garage Door | \$167 | - |
| Gutters | \$140 | - |
| Home Owner Repair | \$87 | _ |

The Whole Home Estimate Explained: You will notice that if you add up every item on your report, the total will never match the Whole Home Estimate total. Why? By using custom calculations we work out not only the individual cost to fix each item, but also the projected cost if ONE contractor per trade were to visit the property and fix all the items at one time. Don't worry, your report is not incorrect and the prices are not meant to match the totals.



WHOLE HOME ESTIMATE:

\$11,577

QUESTIONS?
CLICK HERE TO GET HELP

| # | ltem | Pg | Action | Projected |
|----|--|----|---|-----------|
| 1 | FRAMER. Walkways, Patios & Driveways DECK FLOORING LOOSE OR DAMAGED Deck flooring is loose and can be compromised due to contact with water or other. Have repair or replaced. | 15 | Repair noted items to extend life of deck and improve safety. | \$450 |
| | | | Sub-Total (Framer). | \$450 |
| | CARPENTER/HANDYMAN. | | | |
| 2 | Eaves, Soffits & Fascia GAP There is opening, gap or hole in fascia / soffit which should be repaired. This can allow water intrusion | 10 | Replace and secure damaged areas noted to prevent moisture | \$434 |
| - | and rodent infestation as well as deterioration of the surrounding material. | 10 | intrusion. | Ψ-0 |
| 3 | Eaves, Soffits & Fascia SOFFIT VENT DAMAGED Damaged vents allow moisture and animal intrusion. | 10 | Pricing in adjacent defect. | |
| | Siding, Flashing & Trim CRACKING - MINOR Siding showed cracking in one or more places. This is a result of temperature changes, | | Repair noted areas and seal to extend life of materials. | \$597 |
| | and typical as homes with stucco age. Recommend monitoring. | | | |
| 5 | Siding, Flashing & Trim DAMAGE Siding has damage that may require repair to reduce impact on rest of structure. Have repaired by | 12 | Pricing in adjacent defect. | |
| | licensed contractor. | | | |
| 6 | Siding, Flashing & Trim GAP PRESENT A gap can lead to moisture or animal intrusion. Best to seal with exterior foam if possible to | 12 | Seal penetrations and openings to prevent rodent and moisture | \$207 |
| | prevent future damage. | | intrusion. | |
| 7 | Exterior Doors HARDWARE MISSING Door is missing one or more pieces of hardware. Recommend replacing or upgrading. | | Install or repair hardware in noted locations. | \$218 |
| 8 | Exterior Doors WATER INTRUSION PRESENT Weather seal may be damaged or door was left ajar allowing water intrusion to come in. | 14 | Repair or replace weather stripping in noted areas. | \$125 |
| 9 | Doors DOOR STICKS Door sticks and is tough to open. Recommend sanding down offending sides. Here is a helpful DIY article on | 46 | Adjust noted doors to operate correctly. | \$168 |
| | how to fix a sticking door. | | | |
| 10 | Doors DOOR DOES NOT OPEN OR CLOSE PROPERLY Door may be off frame or damaged preventing proper opening and closing. | 46 | Pricing in adjacent defect. | |
| 11 | Doors mechanism missing or damaged. | 47 | Pricing in adjacent defect. | |
| | | | Sub-Total (Carpenter/Handyman). | \$1,749 |
| | | | | |
| | ELECTRICIAN. | | | **** |
| 12 | Main & Subpanels, Service & Grounding, Main Overcurrent Device DOUBLE TAP PRESENT Double taps are when two or more wires | 34 | Install auxiliary bus bar to improve safety. | \$350 |
| | are connected into one breaker. This can cause overheating and lead to panel and or electrical damage. Please have repaired by electrician. Repair requires adding a new breaker for extra wiring component. | | | |
| 12 | Main & Subpanels, Service & Grounding, Main Overcurrent Device MISSINGS SCREWS Panel requires appropriate fastening. | 25 | Service call to fix noted items. | \$114 |
| | Main & Subpanels, Service & Grounding, Main Overcurrent Device BREAKER STAYS TRIPPED breaker wont reset and can mean | | Repair noted items to improve safety. | \$284 |
| '- | theres a short circuit. Should be inspected by certified technician. | 50 | | Ψ20-4 |
| 15 | Branch Wiring Circuits, Breakers & Fuses IMPROPER WIRING. | 36 | Rewire or change breaker as needed to improve safety. | \$200 |
| - | Branch Wiring Circuits, Breakers & Fuses CONDUIT NOT SECURE Conduits carry live wires and should be properly secured to | | Secure conduit to protect wires and improve safety. | \$160 |
| | prevent pulling damage. | | | |
| 1 | | | · · · · · · · · · · · · · · · · · · · | |

| # | Item | Pg | Action | Projected |
|----|---|----|---|-----------|
| 17 | Branch Wiring Circuits, Breakers & Fuses OPEN WIRING Wiring is open and not properly protected or secured. This could lead to | | Service call to secure, adjust or relocate wires. | \$185 |
| | electrical damage. | | | |
| 18 | Lighting Fixtures, Switches & Receptacles COVER PLATES DAMAGED One or more receptacles have a damaged cover plate. | 37 | Pricing in adjacent defect. | |
| | Recommend replacement. | | | |
| 19 | Lighting Fixtures, Switches & Receptacles COVER PLATES MISSING One or more receptacles are missing a cover plate. This causes | 38 | Pricing in adjacent defect. | |
| | short and shock risk. Recommend installation of plates. | | | |
| 20 | Lighting Fixtures, Switches & Receptacles LIGHT OR FIXTURE LOOSE AND OR SEPARATING FROM WALL Loose fixtures can | 39 | Secure noted fixtures throughout to improve safety. | \$190 |
| | allow moisture intrusion and cause damage to wall and or electrical. Tighten or reinstall as necessary. | | | |
| 21 | Lighting Fixtures, Switches & Receptacles OUTLET IS LOOSE A loose outlet can lead to improper connection of wiring and should be tightened appropriately. | 39 | Repair or install outlet, switch covers and secure throughout. | \$171 |
| 22 | Lighting Fixtures, Switches & Receptacles NO POWER OR TRIPPED If GFCI outlet may be tripped. Otherwise, no power to | 40 | Fault find and repair noted outlets. | \$249 |
| | receptacle which can be an issue of loose wiring or damaged wiring. Have electrician review. | | | |
| 23 | Smoke Detectors MISSING. | 40 | Install more smoke alarms as needed throughout. | \$198 |
| | | | | |
| | | | Sub-Total (Electrician). | \$2,101 |
| | PAINTER/DRYWALL. | | | |
| 24 | Exterior Doors CAULKING MISSING ON SCREWS Exposed exterior screws require caulking to avoid rusting and damaging frame. | 12 | Seal and caulk as needed in noted locations and penetrations. | \$368 |
| 25 | Windows WATER INTRUSION Moisture intrusion can come from leaving a window open or a poor weather seal. | | Correctly seal noted windows to extend life of frame. | \$360 |
| 26 | | | After leak detection patch moisture damaged areas noted on the | \$595 |
| 20 | The source of moisture may have been corrected. Recommend further examination by a qualified contractor to provide confirmation. | 50 | report. | Ψυσου |
| | The course of motoria may have been contented. Necestimon of a qualification by a qualification to provide communication. | | Toport | |
| 27 | Walls DRYWALL BULGING Drywall can bulg when the support materials behind the wall begin to expand and or contract. This | 50 | Patch areas of Sheetrock and paint areas noted throughout report, | \$499 |
| | sometimes causes minor cracking. Patch the cracks as needed. | | including loose tape. | |
| 28 | Walls PATCH WORK PRESENT Previous repair present. | 51 | Pricing in adjacent defect. | |
| 29 | Ceilings PATCH WORK Patches are present due to previous openings or repairs. No concern unless otherwise indicated as poor | 51 | Repair and seal noted areas after evaluation. | \$493 |
| | repair or damaged. | | | |
| 30 | Dryer COSMETIC Concern is not cosmetic and should not affect use. | 57 | Touch up paint noted items. | \$450 |
| 31 | Ceiling PRIOR WATER DAMAGE Signs of previous leaking or water damage present. | 59 | After leak detection patch moisture damaged areas noted on the | \$595 |
| | | | report. | |
| 32 | Walls & Firewalls GAP PRESENT hole or gap present in drywall material. Can be from damage or poor repair/installation. | 60 | Make repairs and seal to improve safety. | \$340 |
| | | | | |
| | | | Sub-Total (Painter/DryWall). | \$3,700 |
| | DILIMPED | | | |
| 22 | PLUMBER. Drain, Wester & Vent Systems LEAKING DIDE A drain, westered for vent pine showed signs of a leak. Recommend a qualified | 20 | Papair lagkage as peeded to provent demage | ¢450 |
| 33 | Drain, Waste, & Vent Systems LEAKING PIPE A drain, waste and/or vent pipe showed signs of a leak. Recommend a qualified | 28 | Repair leakage as needed to prevent damage. | \$150 |
| | plumber evaluate and repair. | | | |

| # | Item | Pg | Action | Projected |
|----|--|----|--|-----------|
| 34 | Drain, Waste, & Vent Systems LEAKING FAUCET Water is leaking from faucet. Can cause water damage to surrounding area. Consider repairing or replacing. | 29 | Repair and service fixtures noted. | \$125 |
| 35 | Drain, Waste, & Vent Systems FAUCET HANDLE LOOSE Recommendation Recommended DIY Project. | 29 | Make necessary repairs to fixtures throughout. | \$155 |
| | Drain, Waste, & Vent Systems DIVERTER NOT PROPERLY WORKING The diverter pushes water out to the shower head. A non | | Adjust valve to direct all water during operation. | \$122 |
| | functioning diverter does not allow full pressure to be distributed one way. Repair or replace as needed. | | | |
| 37 | Drain, Waste, & Vent Systems DRAIN STOP NOT WORKING AS INTENDED. | 30 | Install or repair drain stoppers in areas as needed. | \$115 |
| 38 | Drain, Waste, & Vent Systems TOILET LEAK Moisture is present around base of toilet and can be due to poor fastening of toilet. | 30 | Service call to repair commodes, lavatory and secure to floor. | \$145 |
| 39 | Garbage Disposal INOPERABLE Garbage disposal was inoperable at the time of inspection. Recommend qualified handyman repair. | 56 | Service call to change out or repair disposal. | \$240 |
| 40 | Garbage Disposal SIGNS OF LEAKING AND OR DAMAGE Unit appears to have leak damage and may suggest that unit is at end of life. If active consider replacing before excessive damage occurs. | 56 | Pricing in adjacent defect. | |
| | | | Sub-Total (Plumber). | \$1.052 |
| | | | Cub Total (Francos), | Ψ1,002 |
| | HVAC. | | | |
| 41 | Cooling Equipment INSULATION MISSING OR DAMAGED Missing or damaged insulation on refrigerant line can cause energy loss and condensation. | 21 | Insulate AC lines. | \$122 |
| 42 | Cooling Equipment COILS DIRTY Dirty coils can lead to air handling working twice as hard to produce cold air throughout the home. | 22 | Service call to clean and repair coils and improve air flow, install | \$208 |
| | Regular maintenance is required. Cleaning coils for both compressor and air Handler can save money in energy costs and future | | insulation where needed. | |
| | repairs. | | | |
| 43 | Cooling Equipment CONDENSER LOOSE FROM SLAB Unit should not be loose but strapped down doe risk of future damage. | 22 | Anchor to pad to improve safety. | \$200 |
| | | | | |
| | | | Sub-Total (HVAC). | \$530 |
| | | | | |
| | ROOFING. | | | |
| 44 | Coverings EXCESSIVE WEAR Excessive wear can be due to poor materials, heavy water contact, or impact damage. Severe wear | 17 | Roof repairs needed in noted areas. | \$520 |
| | and tear could lead to expanded shingle damage and leaking. Have roofing contractor evaluate further for repair or replacement. | | | |
| | | | | |
| 45 | Coverings MORTAR CRACKING OR MISSING Mortar helps seal tiles together and prevent additional moisture intrusion. Cracking is | 17 | Roof repairs needed in noted areas. | \$850 |
| | normal but can indicate wear or age on roof. Excessive cracking can lead to movement or shift of tiles. | | | |
| | | | Sub-Total (Roofing). | \$1,370 |
| | | | Sub-Total (Noolling). | \$1,570 |
| | LANDSCAPER. | | | |
| 46 | Vegetation, Grading, Drainage & Retaining Walls TREES AND OR PLANTS AGAINST HOUSE Vegetation can cause staining and wall | 16 | Cut back from structure in all areas | \$249 |
| | damage. Vegetation should be trimmed back to avoid damage. | | | 42.10 |
| 47 | Drain, Waste, & Vent Systems UNABLE TO INSPECT Damage or lack of water is preventing inspector from testing and or inspecting | 31 | Clear drainage of debris to improve flow of water. | \$300 |
| | area. | | , | |
| 1 | | | | 1 |

| # | ltem | Pg | Action | Projected |
|----|---|----|--|-----------|
| 48 | Irrigation system IRRIGATION PUMP NOT WORKING OR UNABLE TO TEST Irrigation pump is too old or too damaged to operate. Unit may not be fully functional and should be reviewed by exterior irrigation specialist. | 31 | Repair noted items and service system. | \$343 |
| 49 | Irrigation system pump appears excessively worn unit appears to be at end of life. Consider replacement. | 32 | Replace pump. | \$512 |
| | | | Sub-Total (Landscaper). | \$1,404 |
| | WINDOW. | | | |
| 50 | Windows TRIM MISSING OR DAMAGED. | 48 | Repair window trim and paint. | \$320 |
| | | | Sub-Total (Window). | \$320 |
| 51 | GARAGE DOOR. Garage Door WEATHER STRIPPING DAMAGED OR MISSING Weather stripping prevents water or animals from entering garage. If damage consider replacing or repairing. Minor concern item. | 61 | Repair or install as needed. | \$167 |
| | | | Sub-Total (Garage Door). | \$167 |
| 52 | APPLIANCE. Refrigerator FREEZER TEMP ABOVE 0 Temperatures should not exceed 0 F and may suggest incorrect temp setting or deficiency in unit. Regular maintenance may be required and or solve cooling irregularity. | 55 | Service to improve efficiency and extend life of the system. | \$100 |
| 53 | Range/Oven/Cooktop DOOR NOT FUNCTIONING PROPERLY. | 55 | Service call to adjust or repair noted items. | \$110 |
| | | | Sub-Total (Appliance). | \$210 |
| 54 | CONCRETE CONTRACTOR. Walkways, Patios & Driveways PATIO CRACKING - MINOR Normal settling & cracking observed. Recommend monitor and/or patch/seal. | 15 | Fill gaps with MP1 sealer to prevent water intrusion. | \$250 |
| | | | Sub-Total (Concrete Contractor). | \$250 |
| 55 | GUTTERS. Gutters and Downspouts DAMAGED, LEAKING, OR MISSING Requires repair as downspout or gutter is not functioning as intended. | 9 | Service call to repair or replace downspout. | \$140 |
| | | | Sub-Total (Gutters). | \$140 |
| | FLOORING. | | | |

| # | ltem | Pg | Action | Projected |
|----|---|----|--|-----------|
| 56 | Floors DAMAGED (GENERAL) The home had general moderate damage visible at the time of the inspection. Recommend service by a qualified contractor. | 49 | Service call to patch damaged section. | \$540 |
| 57 | Floors GAP PRESENT BETWEEN FLOORING MATERIAL Floor may not be properly installed or moving apart which can lead to small cosmetic wear. | 49 | Pricing in adjacent defect. | |
| | | | Sub-Total (Flooring). | \$540 |
| | VENTS. | | | |
| | Dryer EXHAUSTS INTO LIVING AREA Dryer exhaust may be venting into usable space. | | Vent to exterior and clear out lint or debris to improve safety. | \$240 |
| 59 | Walls & Firewalls DAMAGED VENT May allow moisture or animal intrusion. Seal as needed. | 60 | Correctly seal penetration to prevent moisture laden air back into property. | \$120 |
| | | | Sub-Total (Vents). | \$360 |
| 60 | HOME OWNER REPAIR. Lighting Fixtures, Switches & Receptacles LIGHT INOPERABLE One or more lights are not operating. New light bulb possibly needed. | 38 | Secure fixtures, replace bulbs and install covers where needed. | \$87 |
| | | | Sub-Total (Home Owner Repair). | \$87 |
| 61 | FURTHER ACTION REQUIRED. Siding, Flashing & Trim CRACKING - MAJOR Moderate to major cracking was observed at one or more points on the exterior. This can be the result of poor original compaction of soil at the time of construction or excess moisture in the underlying soil. Recommend consulting with a structural engineer and/or soil expert. | 11 | Structural engineer or foundation specialist needed to inspect structural support and recommend repairs. | \$787 |
| | | | Sub-Total (Further Action Required). | \$787 |