	4-r omt msp	ection form	
Insured/Applicant Name:		Application	/ Policy #:
Address Inspected:			
Actual Year Built: 1990		Date Inspected:	
Minimum Photo Requirements ☑ Dwelling: Each side ☑ Roof: Each slope ☑ Plum ☐ Main electrical service panel with interior door label ☑ Electrical box with panel off ☑ All hazards or deficiencies noted in this report A FI			
Be advised that Underwriting will rely on the informat This information only is used to determine insurability			ed from the Florida licensed professional of your choice. less or longevity of any of the systems inspected.
Electrical System Separate documentation of any aluminum wiring reme	diation must be provided and	I certified by a licensed elec	etrician.
Main Panel		Second Panel	
Type: ☑ Circuit breaker ☐ Fuse Total Amps: 225		Type: ☐ Circuit breaker ☐ Fuse Total Amps:	
Is amperage sufficient for current usage? ✓ Yes ☐ No	o (explain)		urrent usage? Yes No (explain)
Indicate presence of any of the following: Cloth wiring Active knob and tube Branch circuit aluminum wiring (If present, describe * If single strand (aluminum branch) wiring, provide det Connections repair via COPALUM crimp Connections repair via AlumniConn	-	-	ust be provided.
Hazards Present		✓ Double taps	
☐ Blowing fuses		Exposed wiring	
☐ Tripping breakers		☐ Unsafe wiring	
Empty sockets		☐ Improper breaker size	
Loose Wiring		☐ Scoring	
☐ Improper grounding		Other (explain)	
☐ Corrosion			
Over fusing			
General condition of the electrical system: Satisfact	ory Unsatisfactory (expla	in)	
Supplemental information			
Main Panel	Second Panel		Wiring Type
Panel age: 27	Panel age:		Copper
			✓ NM, BX or Conduit

Year last updated:_

Brand/Model:

CR Pro Home Inspections 05/09/2020

Year last updated: 1993

Brand/Model: Cutler Hammer

HVAC System								
Central AC: ✓ Yes Central heat: ✓ Yes	☐ No							
If not central heat, indicate p Are the heating, ventilation a			vyorking andar? 🗖 Va	No (ovulain)				
		UNKNOWN	working order? Yes	s 🔲 No (explain)				
Date of last HVAC servicing	/inspection:	OTTRITOWIT						
Hazards Present Wood burning stove or centr Space heater used as primary Is the source portable? ☐ Does the air handler/condens ☐ Yes ☑ No	heat source? [Yes No	Yes ₩ No			he surrounding are	a?		
Supplemental Information								
Age of system: 6 Year last updated: 2014 (Please attach photo(s) of HV	AC equipment,	including dated man	ufacturer's plate)					
Plumbing System								
Is there a temperature pressu Is there any indication of an an Is there any indication of a p Water heater location:	active leak?	Yes 🔽 No	Yes No					
General condition of the fol	lowing plumbin	g fixtures and conr	nections to applicances:					
Dishwasher Refrigerator Washing Machine Water Heater Showers/Tubs	Satisfactory	Unsatisfactory	N/A	Toilets Sinks Sump pump Main shut off valve All other visible	Satisfactory	Unsatisfactory □ □ □ □ □ □ □	N/A	
If unsatisfactory, please pro	vide comments,	details (leaks, wet/	soft spots, mold, corrosi	ion, grout/caulk, etc.).				
Supplemental Inform	nation							
Age of Piping System: Original to home Completely re-pip X Partially re-piped (Provide year and extent of re		comments below)		Type of pipes (check all Copper PVC/CPVC Galvanized PEX Polybutylene Other (specify)	l that apply)			

Des Carrier			
Roof (With photos of each roof slope, this	section can take the place of the	e Roof Inspection Form.)	
Predominant Roof Covering material: Concrete Tile		Secondary Roof Covering material: Modified Bitumen	
Roof age (years): 8		Roof age (years): 8	
Remaining useful life (years): 22		Remaining useful life (years): 12	
Date of last roofing permit: 2012		Date of last roofing permit: 2012	-
Date of last update: 2012		Date of last update: 2012	
If updated (check one):		If updated (check one):	
✓ Full Replacement		✓ Full Replacement	
Partial Replacement		☐ Partial Replacement	
% of replacement		% of replacement	
Overall condition:		Overall condition:	
✓ Satisfactory		✓ Satisfactory	
☐ Unsatisfactory (explain below)		Unsatisfactory (explain below)	
Any visible signs of damage / deterioration?		Any visible signs of damage / deterioration?	?
(check all that apply and explain below)		(check all that apply and explain below)	
☐ Cracking		☐ Cracking	
☐ Cupping/Curling		Cupping/Curling	
Excessive granule loss		Excessive granule loss	
Exposed asphalt		Exposed asphalt	
Exposed felt		Exposed felt	
☐ Missing/loose/cracked tabs or tiles		☐ Missing/loose/cracked tabs or tiles	
Soft spots in decking		☐ Soft spots in decking	
☐ Visible hail damage		☐ Visible hail damage	
Any visible signs of leaks ☐ Yes ☑ No Attic/underside of decking ☐ Yes ☑ No		Any visible signs of leaks ☐ Yes ☑ No Attic/underside of decking ☐ Yes ☑ No	
Interior ceilings Yes V No		Interior ceilings Yes No	
Additional Comments/Observation	ons (use additional pages i	if needed):	
All 4-Point Inspection Forms must be comp	leted and signed by a verifiable I	Florida-licensed inspector.	
I certify that the above statements are true as		-	
	HOME INSPECTOR	HI10185	05/09/2020
Inspector Signature	Title	License Number	Date
Impector Signature		Diceinse I valificei	
CR Pro Home Inspections	HOME INSPECTOR	(305) 912 7679	
Company Name	License Type	Work Phone	-

CR Pro Home Inspections 05/09/2020

Special Instructions: This sample *4-Point Inspection Form* includes the minimum data needed for Underwriting to properly evaluate a property application. While this specific form is not required, any other inspection report submitted for consideration must include at least this level of detail to be acceptable.

Photo Requirements

Photos must accompany each 4-Point Inspection Form. The minimum photo requirements include:

- Dwelling: Each side
- · Roof: Each slope
- Plumbing: Water heater, under cabinet plumbing/drains, exposed valves
- · Open main electrical panel and interior door
- Electrical box with the panel off
- All hazards or deficiencies

Inspector Requirements

To be accepted, all inspection forms must be completed, signed and dated by a verifiable Florida-licensed professional. Examples include:

- · A general, residential, or building contractor
- A building code inspector
- A home inspector

Note: A trade-specific, licensed professional may sign off only on the inspection form section for their trade. (e.g., an electrician may sign off only on the electrical section of the form.)

Documenting the Condition of Each System

The Florida-licensed inspector is required to certify the condition of the roof, electrical, HVAC and plumbing systems. *Acceptable Condition* means that each system is working as intended and there are no visible hazards or deficiencies.

Additional Comments or Observations

This section of the 4-Point Inspection Form must be completed with full details/descriptions if any of the following are noted on the inspection:

- Updates: Identify the types of updates, dates completed and by whom
- Any visible hazards or deficiencies
- Any system determined not to be in good working order

Note to All Agents

The writing agent must review each 4-Point Inspection Form before it is submitted with an application for coverage. It is the agent's responsibility to ensure that all rules and requirements are met before the application is bound. Agents may not submit applications for properties with electrical, heating or plumbing systems not in good working order or with existing hazards/deficiencies.

Photos, Additional Comments or Observations

Exterior Photos










Electrical System


Panel Photos

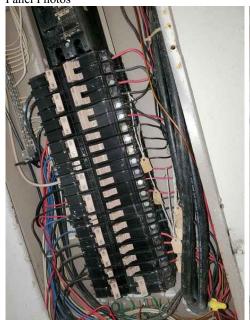







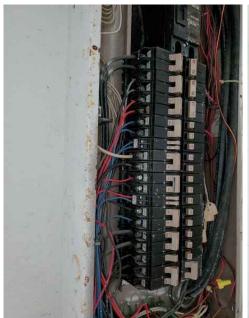



Additional Photos


Hazards



HVAC System HVAC Equipment



PRODUCT NO.	FA4CNC836088AAAA	
MODEL NO.	FA4CNC036	
SERIAL NO.	4905A71414	o(Ut)
VOLTS	208/230	C TL/US
MOTOR HP	1/3	LISTED FAN COLL UNIT JUST
MOTOR FLA PHASE/HERTZ	1/60	UNIT SIGH
TEST STATIC	.20 IN. W.C.	
REFRIGERANT 22	DESIGN PSIG 300	
1 (market market	APPROVED ACCESSORIES	7/
RECENTATION RECENT	KFCEH**01F18 KFCEH**01C20 KFCEH**01C10 KFCEH**01C20 KFCEH**01F18 KFCEH**01F18 KFCEH**01F18 KFCEH**01F18	ATCEST OINGS NCCHT OICH
LIFE HEATER AND MAKE OF THE PROPERTY OF THE PR	LABOR SECTION OF A TURN AND A SECTION OF ANY ASSESSMENT OF A SECTION O	V 30, 1/43, 0 M/A M/A

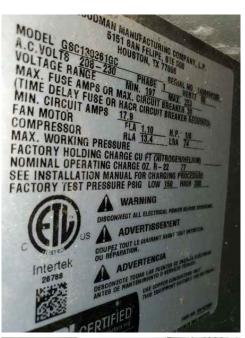











Plumbing System

Water Heater








Under cabinet plumbing & drains







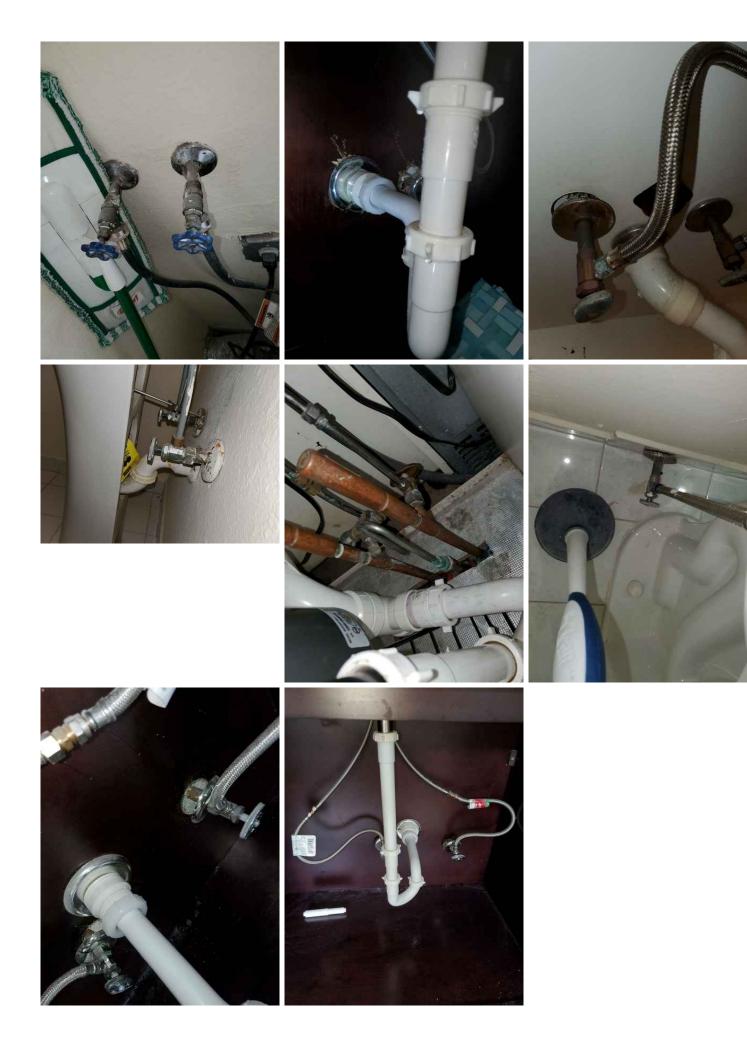

Roof

Photos of Each Slope







